


IMPORTANT: Installation instructions are shown with Reven and applies to Reven, Camber and Smile fixtures


NOTE: Wire dimming conductors as Class 1

1 SINGLE FIXTURE

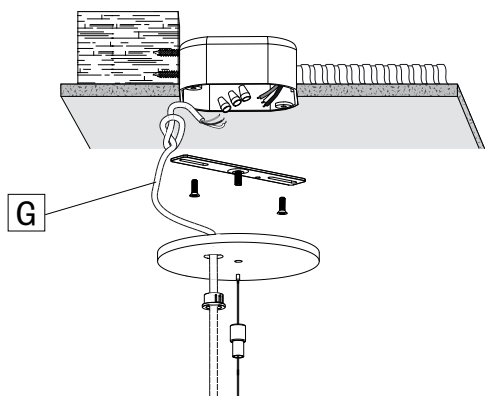


Locate ceiling mounting points according to supplied client drawing. **If using a Yoke cable mounting**, place your mounting points to your wanted length. Make a knot in the power cord (G) and then connect it to the ceiling power feed.

2 POWER SIDE

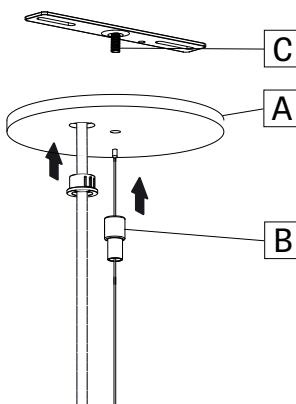


Secure canopy (A) with slip ring (B) on threaded rod (C). For a continuous system, please proceed to step 6.

3 NON-POWER SIDE

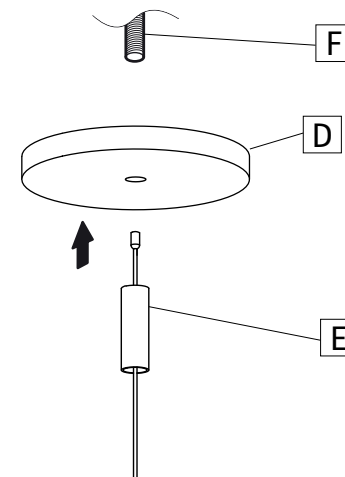


Secure canopy (D) with cable coupler (E) on crimp strut (1/4"-20) (F) (by other).

4

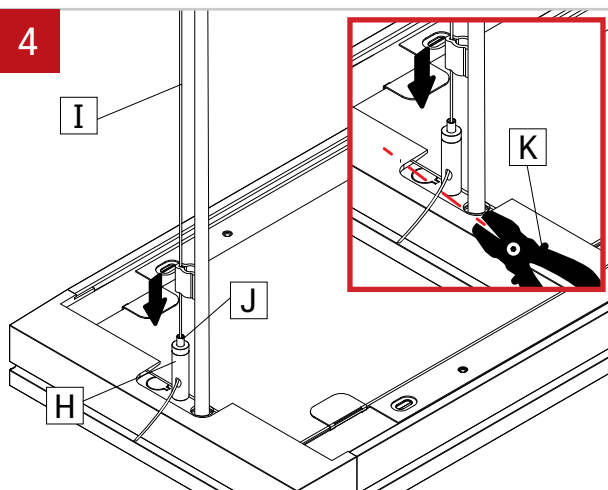


Insert the aircraft cable (I) into the griplock (H). Repeat on both sides of fixture. Adjust the cable (I) length to level fixture by pushing the feeder tube (J). **Cut the excess cable** with a cable cutter (K).

5

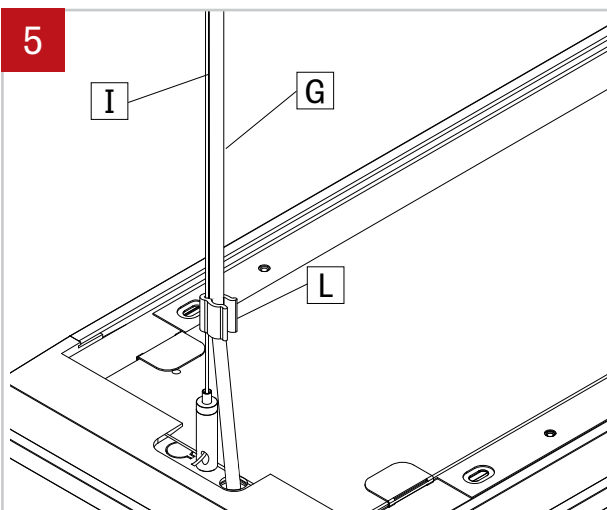


Secure power cord (G) to aircraft cable (I) with plastic clip (L).

6 YOKE CABLE

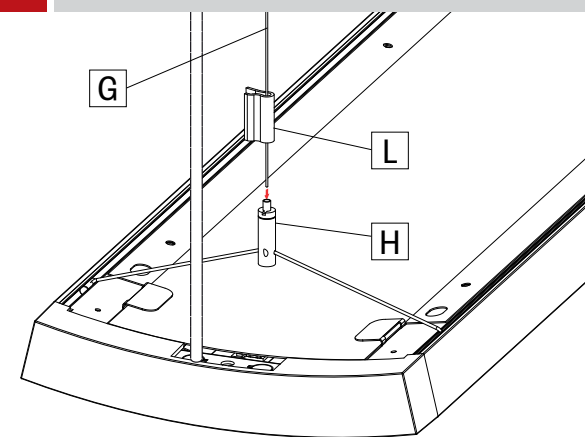


Insert the aircraft cable (G) into the griplock (H) and repeat on both sides of fixture. Secure power cord to aircraft cable with plastic clip (L).

7 YOKE CABLE

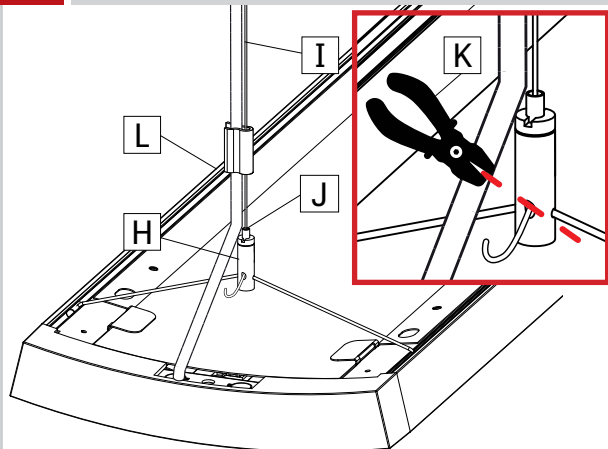


Level fixture (L) using the griplock (H). To adjust the cable (I) height, push the feeder tube (J) downward. **Cut the excess cable** with an aircraft cable cutter (K).

8 CONTINUOUS SYSTEM

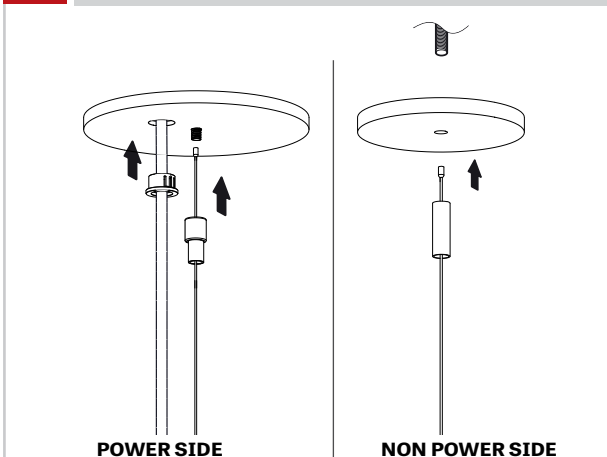


For a continuous system, repeat steps 1 to 3 for all mounting points. Repeat steps 4 and 5 for the first fixture at the end of the extremity.

9

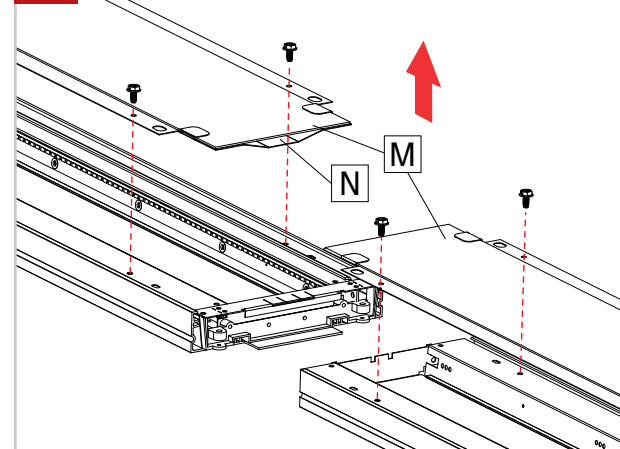


Unscrew and remove the top reflectors (N) (the dust covers (M) should be attached). Repeat for all fixtures in the run.

10

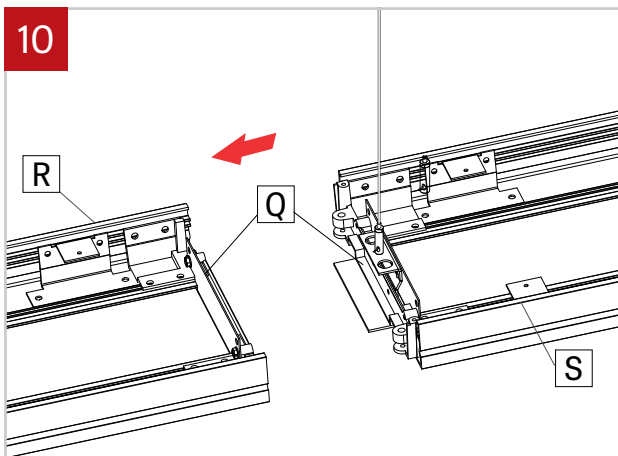


Apply steps 4 and 5 to the next mounting points. Align the joiners (Q) at the end of the fixtures (R) and (S) and connect them.

11

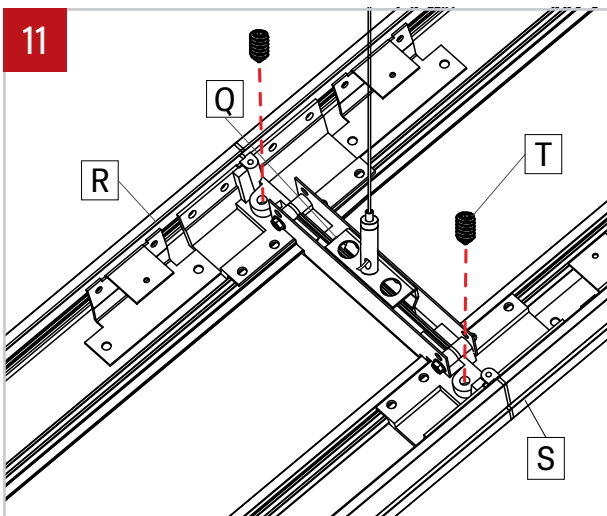

Secure the two fixtures (S) and (R) by fastening security screws (T) to the joiners (Q).

12

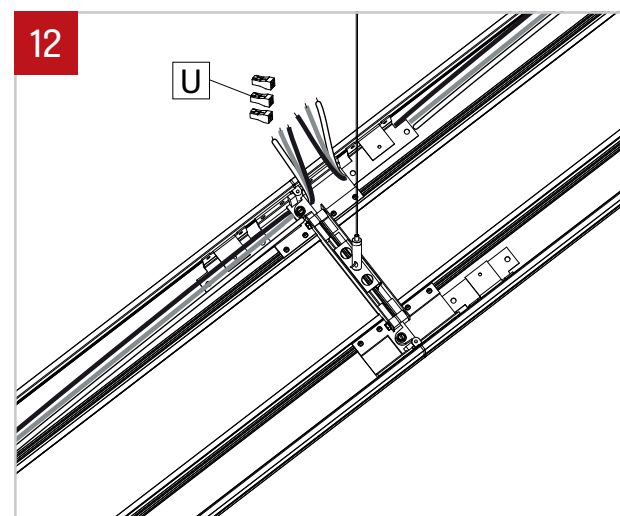

Connect wires between joining fixtures using quick connectors (U). Repeat for all other fixtures in the run.

